

Release note

LinkCom 5 S, LinkCom 5 M, EasyCom 5

Versions:

- LinkCom 5 S, version S80 652.100, December 1., 2022
- LinkCom 5 S, version S80 652.101, December 1., 2022 (US market default settings)
- LinkCom 5 M, version S80 656.100, December 1., 2022
- EasyCom 5, version S80 654.100, December 1., 2022

Firmware upgrade requirements

LinkCom and EasyCom PrintServers must run firmware version 65x.050 or newer before upgrading to this new firmware version 65x.10x.

Once upgraded to version 65x.10x the firmware cannot be downgraded.

With this firmware version we have introduced a firmware version with US market default settings for LinkCom 5 S. US specific firmware versions are numbered S80 652.xx1.

New Features

- New Webserver design. It is now a requirement to first login to the PrintServers webpage before main PrintServer information becomes visible.
- Upload and download of PrintServer configuration via the PrintServer webserver. Printer templates can also be uploaded. Please notice: Upload file size may not exceed 65 KB. Please refer to the LinkCom 5 or EasyCom 5 User Guide for more information.

Corrections

Webserver:

- Internal PrintServer health logfiles will be preserved following a restart and can be extracted from the PrintServer webpage.
- Entering a "Blank" address for the TCP/IP Gateway address via the web interface causes a crash. Fixed.
- Enabling/disabling ABC/FTP logical printer via the web interface does not take effect. Fixed (Relevant only for LinkCom 5 S).
- Web interface. ICDS settings. Enabling "Autoconfig" and "Edge to Edge" does not take effect. Fixed

IPDS:

- Graphic character misplacement fixed.
- Problem with color/greyscale image without a FullColor license (in IOCA Data stream) fixed.
- "%FORM%" tag in subject field has no effect-. Fixed. Relevant supported AS400 and SystemZ job Tags of the following types can be included in the PostScript or PCL printer output data as part of the PJJ

header information:

%JOBNAME%_%USERNAME%_%COPIES%_%PRIO%_%FORM%_%LIBNAME%_%DEVNAME%_%JOBID%_%SESSNAME%_%SESSID%

ABC/FTP: (Only relevant for LinkCom 5 S)

- Some PDF 417 barcodes will not scan. Fixed.
- Some PDF 417 barcodes contain data from barcodes on a previous page of the job. Fixed.

Concern

Replaces earlier release S80 65x.090 and will be introduced for all future orders.

Customers with valid maintenance can update to the newest version of the firmware.

Please contact [MPI Tech Support](#) for further information.